

Madera Unified School District

1902 Howard Road, Madera, CA 93637
559.675.4500
Fax: 559.675.1186
www.madera.k12.ca.us

January 16, 2024

Addendum No.2-Bid No. 010324-Plumbing Infrastructure Project at Multiple School Site
Kitchens

NOTICE TO ALL VENDORS:

This addendum is attached to and made a part of the above-entitled specifications for Madera Unified School District for Bid No. 030623- Bid No. 010324-Plumbing Infrastructure Project at Multiple School Site Kitchens, with a bid turn in date of ~~January 17, 2024 @ 10:00 am~~
January 19, 2024 @ 11:30 am

All changes and/or clarifications will appear in bold type and deletions will be struck out within a sentence.

- Does the trap primer access panel have to be located on the exterior wall?
Yes, the panel is to be located on the exterior wall. Contractor shall cut into exterior wall as required for the new panel and blocking. Contractor shall patch back stucco to match existing and shall paint to match adjacent surfaces.
- Is the hood and stainless-steel paneling on the wall to be removed?
The hood is to remain. The contractor may remove stainless steel wall paneling for utility access, but must patch back wall and reinstall paneling back in place. Contractor may locate risers adjacent to stainless steel paneling within wall section that is covered with FRP. Repair drywall and provide new FRP panel to nearest joint to match existing.
- Is the outline of the sawcut fixed or can it be moved?
The outline is shown for approximate areas for work to occur. Actual saw cutting may be moved to accommodate scope of work. All saw cutting shall occur at grout joints such that whole tiles are placed back. New concrete shall match existing slope. All new tile and cove base shall match existing color and slip resistance texture.
- Cesar Chavez doesn't have an access panel.
Contractor shall cut exiting ceiling, frame new opening, provide new access panel (24"x24" minimum), and texture/paint to match existing. Panel shall be fire rated, steel, insulated, downward opening, concealed pivot hinge with spring assist, with self-latching interior ring latch release, and primed white finish (MIFAB MPFR-DW-24-24 or equal).


Todd Lile
Superintendent

Board of Trustees
Lucy Salazar, President

Ruben Mendoza, Clerk
Nadeem Ahmad

Israel Cortes
Gladys A. Diebert

Joetta Fleak
Ray G. Seibert

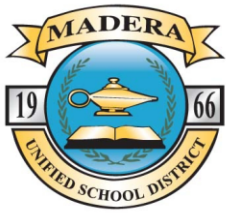

Madera Unified School District

1902 Howard Road, Madera, CA 93637
559.675.4500
Fax: 559.675.1186
www.madera.k12.ca.us

Cont.' Addendum No.2

- Will the kitchens be shut down so that we can move existing equipment to remain?
The kitchen will be shut down for the duration of construction and all equipment can be removed as required for access. MPR will remain in use, and no construction access through MPR will be permitted.
- Does the District have a stock pile of tile? **No, the awarded vendor will be responsible for matching the floor tiles**

Signature: _____

Date: _____

Todd Lile
Superintendent

Board of Trustees
Lucy Salazar, President

Ruben Mendoza, Clerk
Nadeem Ahmad

Israel Cortes
Gladys A. Diebert

Joetta Fleak
Ray G. Seibert